

RESULT OF SPOT CHECK CARRIED OUT WITH POLICE AND VOSA AT NORFOLK ST GARAGE ON 03/06/16

COMPANY	REG & AGE OF VEHICLE	RESULT	ACTION TAKEN BY VOSA & COUNCIL
4 Star - Licence number 381	P6 BUT	Passed vehicle inspection – Defect notice issued for – N/SF indicator bulb, O/S/F Headlight bulb.	Inspected at Norfolk Street garage on 04/06/16 – Faults Repaired.
Street Cars - Licence number 258	NV58 NHZ	Exhaust system leaking, fumes likely to enter vehicle interior, Drivers area littered with ancillary equipment libel to interfere with proper control of vehicle, radio insecure on floor.	Immediate Prohibition- licence suspended – repaired and suspension lifted on 04/06/16
VIP – Licence number 91	SY05 UWL	Battery insecure, displacement constitutes risk of fire, N/S and O/S sliding doors cannot be secured in the open or closed positions.	Immediate Prohibition - Licence suspended – repaired and suspension lifted on 04/06/15
Ace – Licence number 358	SG08 KNR	Excessive movement in steering joint, excessive abnormal movement, N/S Track rod end ball joint.	Delayed Prohibition - Licence suspended – repaired and suspension lifted on 04/06/16
Crown – Licence number 59	WF09 HOA	Battery insecure, displacement constitutes risk of fire, wiring insecure and constitutes risk of fire.	Immediate Prohibition - Licence suspended – repaired and suspension lifted on 04/06/16
UK – Licence number 208	FD58 BPK	Battery insecure, displacement constitutes risk of fire, Defects – Air bag light on, gear box mounting fractured, O/S/F Wing mirror broken.	Immediate Prohibition - Licence suspended – repaired and suspension lifted on 04/06/16
Escort – Licence number 293	BL07 LNX	Battery insecure, displacement constitutes risk of fire, O/S side repeater inoperative, N/S coil Spring fractured.	Immediate Prohibition - Licence suspended – repaired and suspension lifted on 04/06/16
Taxi Assist hired out to Matrix – Licence number 507	PE61 UML	Passed vehicle inspection.	

BCN – Licence number 219	VU07 VFR	Battery insecure, displacement constitutes risk of fire, wiring insecure and constitutes a fire risk engine bay area, N/S Front suspension attachment insecure, wishbone rear mounting bush excessive wear movement evident.	Immediate Prohibition - Licence suspended – repaired and suspension lifted on 04/06/16
Union – Licence number 357	AE58 TRV	Battery insecure, displacement constitutes risk of fire, exhaust system leaking with significant deterioration at flexi, boot required cleaning, N/S/R indicator bulb white, number plate light out.	Immediate Prohibition - Licence suspended – repaired and suspension lifted on 04/06/16.
Kings- Licence number 49	SP60 ZFC	Battery insecure, displacement constitutes risk of fire, wiring insecure and constitutes a fire risk engine bay area, N/S side repeater inoperative, N/S tyre beyond legal limit (1.3mm), excessive movement in steering joint, excessive abnormal movement N/S track rod ball joint, requires new first aid kit & no fire extinguisher.	Immediate Prohibition - Licence suspended – repaired and suspension lifted on 04/06/16.
Cavalier – Licence Number 105	VA11 DSZ	Passed vehicle inspection	
Superline – Licence number 194	DA09 KFW	Battery insecure, displacement constitutes risk of fire.	Immediate Prohibition - Licence suspended – repaired same night, MOT required within 10 days - suspension lifted on 03/06/16.
Victors – Licence number 238	TN07 SDX	Passed vehicle inspection – defect notice issued – required new first aid kit and fire extinguisher, N/SR side light bulb to be replaced, battery cover to be secured, wipers to be replaced.	Inspected at Norfolk Street garage on 04/06/16 – Faults Repaired.